

LAND CORNER RECORD

Index: T-9	Corner: 1/4 Corner between Sections 28 and 29	State of Indiana - Hoosier National Forest	
Section: 29	Township: 7N	Range: 1E	P.M.: 2nd
Coordinate:	Lat./N: 1371743.60	Long./E: 3140006.16	County: Monroe
		Datum: NAD83 IN West Zone, US Survey Feet	


CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:		Monument Photograph:
9/13/1990	Ken Anderson L.S. #80040545	3" Iron pipe with a 3" stamped brass cap was set	USDA Forest Service Bedford, IN		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
	Beech	11"	S72°W	11.50'	
	Sugar Maple*	13"	N89°E	22.00'	
* = tag only					
Record evidence of prior survey:	A wood post was set and referenced in 1814 by Arthur Henrie, Monroe County Surveyor. Recorded in Microfilm Reel 4658.				
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:		
6/12/2007	Kevin Enright Monroe County Surveyor	3" Iron pipe with a 3" stamped brass cap found	Monroe County Surveyor's Office Bk. 39, Pg. 26		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
	Beech	12"	S78°W	10.58'	
	Sugar Maple	13"	S87°E	21.19'	
	Red Oak	16"	S28°E	23.32'	
Record evidence of prior survey:	A 4"X4" wood post with a "SURVEY" sign is S01°W-2.38'.				

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Beech*	15"	S75°W	11.62'
	Sugar Maple*	15"	S87°E	22.33'
	Beech	7"	N11°E	31.58'
* = old blaze at base of tree				
Monument Found or Set:	A 3" iron pipe with a 3" brass cap stamped "T7N R1E 1/4 S.29 S.28 1990 S0545" found 0.5' above grade.			


MONUMENT SKETCH

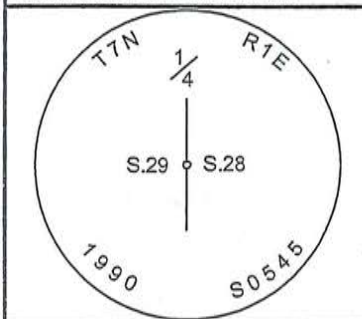

NARRATIVE REFERENCE:

Monument is a 3" iron pipe with a 3" brass cap stamped "T7N R1E 1/4 S.29 S.28 1990 S0545" found 0.5' above grade, a carsonite post is located north 2.0' of the monument, located on the northeast side of a ridge top between two drainages, the ridge top extends from a county road and a forestry pull off, surrounded by mature trees, the convergence of the two drainages is +/- 100' north.

SECTION DIAGRAM

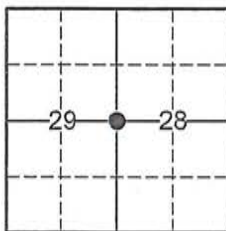

Corner Location = ●

PERPETUATION RECORD:

The record monument was found undisturbed and maintained by remarking two existing bearing trees and establishing one new bearing tree. Two existing bearing trees were recovered from a Monument Record by Kevin Enright, dated 6/12/2007 and remarked.

Three bearing trees were marked with a blaze, scribed B.T., bearing tree sign, paint, and mag nail.

Referenced on BRCJ survey recorded as InstNo.2018004725

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

Section: 29 T7N R1E

Prepared By: BRCJ

(Project#3-0820)

Date: 2/2018

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 28

Township: 7 North


Range: 1 East

Corner ID: Polk I-19

Monument Description & Remarks: 3" Brass Disk stamped "T7N R1E $\frac{1}{4}$ S. 29 S. 28". Survey Sign 4.5ft above ground at pt. B


References On File: Forest Service Monument record on file in Surveyor Office

RECOVERY TIE DRAWING
Field Book 39 Page No. 26

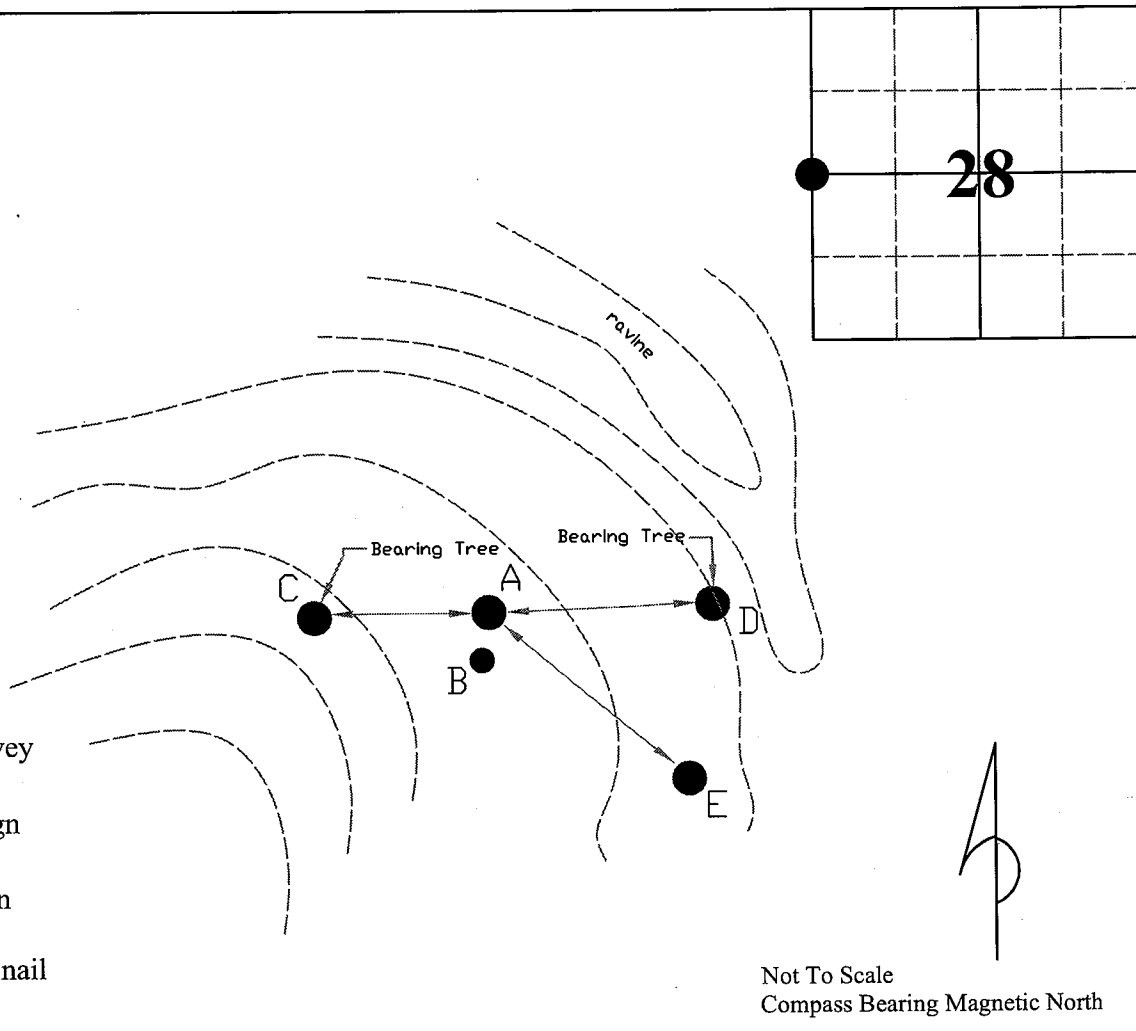

I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of Article 6-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 18th day of April, 2007.

Kevin P. Enright

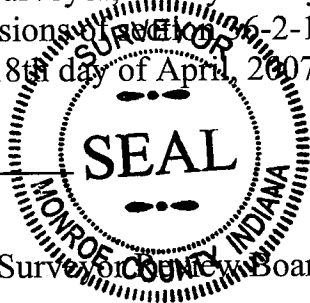

Administered by the Monroe County Surveyor's Board



Date: 6-12-2007 DB

Index No T-9 LAND CORNER RECORD FSM 7150
 T. 7N R. 1E 2nd P. Mer. County Monroe State of Indiana
1/4 Corner common to Sections 28 & 29 Hoosier National Forest

EXISTING SURVEYS

Original Government Survey	Original Survey evidence Found
Year Surveyed <u>1814</u> By <u>A. Henrie</u>	Date of Search <u>9/90</u> By <u>K. Anderson</u>
Original Monument <u>wood post</u>	Monument Found <u>None</u>
Species <u>Dia</u> Bearing <u>Dist</u>	Orig. Species <u>Dia</u> Bearing <u>Dist</u>
BT's <u>W. Oak 30" S87E 5 LKS</u>	BT's _____
<u>Beech 4" S87W 13 LKS</u>	Found _____
~~~~~	
Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Date Surveyed <u>1860</u> By <u>J.S. Buskirk</u>	Date of Search <u>9/90</u> By <u>K. Anderson</u>
Where Filed or recorded: <u>Monroe</u>	Monument Found _____
Book: <u>2</u> Page <u>27</u> <u>County Surveyors</u>	_____
Found <u>Set "1/2 mile stake"</u>	_____
Monument <u>Set "1/2 mile stake"</u>	_____
BT's Species <u>Dia</u> Bearing <u>Dist</u>	Species <u>Dia</u> Bearing <u>Dist</u>
Ref. <u>"Found old witness"</u>	BT's _____
Obj. _____	Found _____

Subsequent Corner Restoration	Evidence of Subsequent Corner Restoration Found
Date Surveyed <u>1885</u> By <u>M.H. Buskirk</u>	Date of Search <u>9/90</u> By <u>Ken Anderson</u>
Where Filed or recorded: <u>Monroe</u>	Monument Found <u>None - Search area is</u>
Book: <u>2</u> Page <u>418</u> <u>County Surveyors</u>	<u>on a N,NE by slope near Nly end of</u>
Monument: <u>Does not say what monument, S any way</u>	<u>spur ridge from corner to drains - N45W</u>
BT's Species <u>Dia</u> Bearing <u>Dist</u>	Species <u>Dia</u> Bearing <u>Dist</u>
Ref. <u>Beech 12" N11E 54 LKS</u>	BT's <u>No evidence of BT's was</u>
Obj. <u>Beech 12" N54W 53 LKS</u>	Found <u>found</u>

OTHER EVIDENCE

Describe corner location relative to nearby features and how to reach the corner location - note fences roads, timber, streams, topo changes, etc: Corner Search and traverse was done in 1978-9 by USFS crew under my direction. At that time the iron pipe was set - 40 inches in ground with 8" exposed - and 4"x4" wood post with survey sign was set 3 1/2 feet south of monument. Stone ring piled around pipe. Monument is in a hardwood timber stand.

Sketch of Monument



PERPETUATION RECORD

Monument: Describe new monument set, or work done to preserve existing monument.

Set Iron Pipe monument (2 3/4" O.D. x 48" Long) with 3" Brass Cap stamped to identify the corner. Wood survey sign post set previously.

Accessories: Describe new Bt's and/or witness objects established or work done to preserve existing evidence

<u>Beech (Scribed)</u>	<u>Sugar Maple (Not scribed but tagged)</u>
<u>11" (4)</u>	<u>13"</u>
<u>S72W (tagged)</u>	<u>N89E</u>
<u>11.5 FT</u>	<u>28.0 FT</u>
	<u>County Blacktop road is 900 FT South</u>

CORNER DIAGRAM

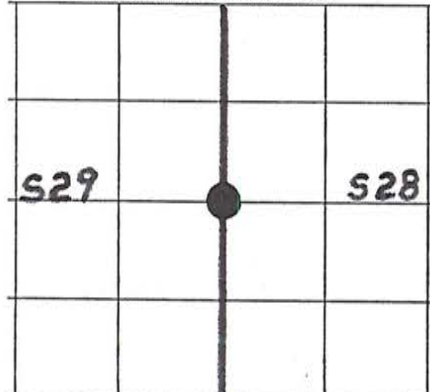


Photo Identified _____	Corner Recordation _____	Yes _____
Photo # _____	Certificate prepared: _____	No _____
Strip/Series _____	Filed or recorded in County _____	
Pinpricked _____	Records: Date: _____	
Search Hours <u>1 Minute</u>	Book: _____ Page: _____	

Corner Record by: Kenneth Anderson Date: 9/13/90




POLK 119

Index No. T-9  
 (Alphabetical - Numerical)  
 LAND CORNER RECORD  
 (RECTANGULAR SURVEYS)  
 X9-7150-4 (Rev. 8/13/67)  
 GPO 806-924  
 T. 7N R. 1E 2nd Mer. N.E. Hoosier County Monroe State Indiana  
14 Section Corner common to sections 28 29 and

EXISTING SURVEYS

Original Government Survey.		Original Evidence Found	
Year surveyed <u>1819</u>		Year of search <u>1973</u> By <u>H. Dorton</u>	
Original monument <u>Wood Post</u> (Wood post, stone, pile of stones, pipe, etc.)		Monument found	
Bearing Trees		Original Bearing Trees Found	
Species <u>W. Oak</u>	<u>Beech</u>	Species	<u>Beech</u>
Diameter <u>30"</u>	<u>14"</u>	Diameter	<u>38"</u>
Bearing <u>S87 E</u>	<u>S87 W</u>	Bearing	
Distance <u>51 Ks</u>	<u>13 Ks</u>	Distance	
Subsequent Corner Restoration		Evidence of Subsequent Corner Restoration Found	
Year surveyed _____ By _____		Year of search _____ By _____	
Where filed or recorded _____			
Monument _____ (Original, concrete post, iron rod, etc.)			
Bearing Trees, Reference Objects		Bearing Trees, Reference Objects	
Species _____			
Diameter _____			
Bearing _____			
Distance _____			

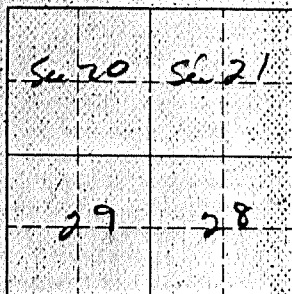

Sketch  
 O Corner ☒ FS. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____  
 Object _____  
 Record distance _____  
 Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber, cutting lines, plantations, etc. Cite source of testimony if any. Found original Bearing tree Beech - found stake set by survey SE of tree 15'

Perpetuation Record

Monument and accessories established. Include brief description of area. _____  
 _____  
 _____  
 Certified corner restoration certificate prepared: Yes _____ No _____  
 Filed in county records at _____ Date _____ County Document No. _____  
 Identified on aerial photo No. _____ Which is filed at _____

At time of search:

- Did you have the record description?  
 Yes _____ No _____
- How was search area located?  
 Pacing, chaining, photos, maps, etc. _____
- Man hours spent in search _____
- Do you think additional search might recover evidence? Yes ☒ No _____
- Signature _____